

EUROPEGAS VER. 2.12 SOFTWARE CHANGES DESCRIPTION

We have discovered following problem in PLUS/OBD CAN software ver. 2.0.9.

Sometimes after pressing the AUTOCALIBRATION button or any of ICONS on the top side of the program window nothing happens.


There was a minor bug in version 2.0.9 of PLUS/OBD CAN application which sometimes placed the active window (like waiting for pressing "OK") button or opening a icon window (like "Correction") below Main program window. In result You might experience situation when the active window waits below Main window and You are not able to do anything with the application window because Active window is not visible. Application which I'm sending to You in attachment fixes that bug and brings few new things (upgrades):

1) In "Switch Panel" the feature so far used as "Use above delay for autocalibration" now works as "Use 0 sec. delay for autocalibration". From now on "Changeover delay per cyl." is only used for regular changeovers between fuels and no longer cannot be used during Autocalibration.

Now in Autocalibration process every FIRST changeover from petrol to gas (and from gas to petrol) now uses 1,5 sec. for each cylinder for changeover. All other changeovers are being done with 0 sec. delay.

It has been done to eliminate necessity of experimental setting that value and make few autocalibration (the engine was stalling sometimes because of lack of gas in rubber pipes going to manifold and fuel trims which didn't manage to change at stable values by the time when all cylinders has been changeovered simutanously).


In other words unexperienced user doesn't have to bother themselves with changing anything in Switch bookmark to finish first autocalibration succesfully. Only for "full-group" controller feature "Use 0 s delay for autocalibration" needs to be activated.

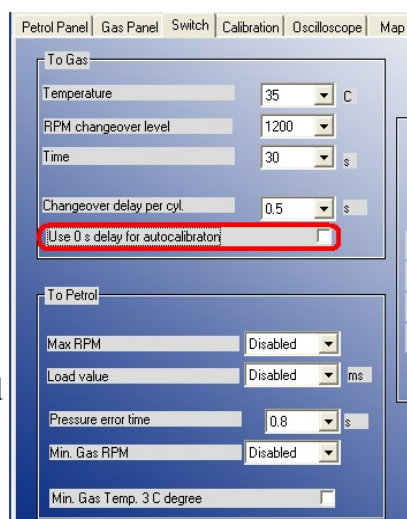

2) As You know before every another autocalibration it is necessary to erase all corrections made by the user (like high "Main correction" value, modified multiplier etc.) to avoid getting incorrect correction after

Autocalibration process.

Now You are automatically reminded to do this if software would detect that any of corrections is different from the standard settings (Main correction different from 1,00 ms, Multiplier different from 1,00, Any field on RPM/ms map different from 0%)

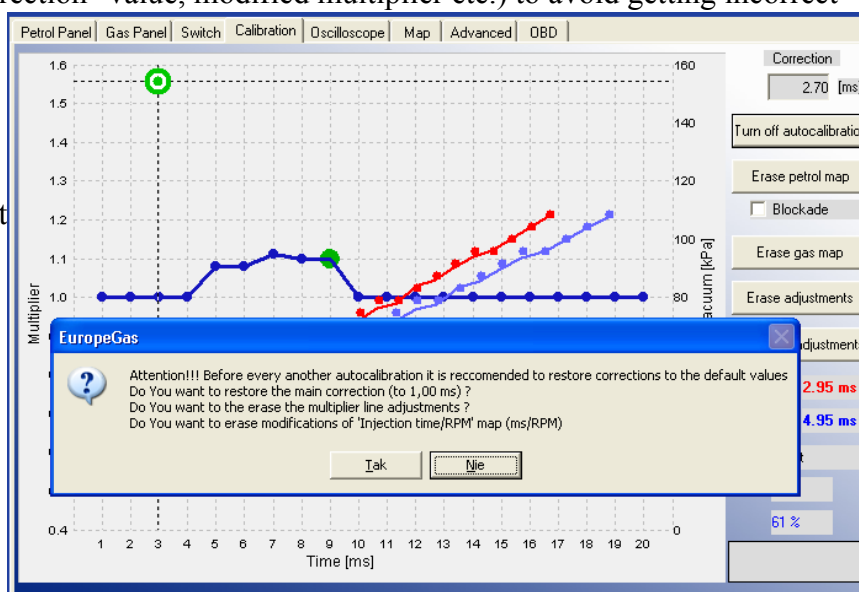

Latest version of software can be downloaded from our website:

http://www.europegas.pl/software/OSCARN_PLUS_OBDCAN_v212.zip